

BROWARD COUNTY UNIFORM BUILDING PERMIT APPLICATION

Revised 11-17-2022

Select One Trade: ☒ Building ☐ Electrical ☐ Plumbing ☐ Mechanical ☒ Other

Application Number: _____ Application Date: _____

1	Job Address: <u>2252-2282 SW 81 Ave</u>	Unit: _____	City: <u>Miramar</u>
	Tax Folio No.: <u>514121AC2120- 2170</u>	Flood Zn: _____	BFE: _____
	Building Use: <u>04 Condominium</u>	Floor Area: _____	Job Value: _____
	Present Use: <u>04 Condominiumg</u>	Construction Type: _____	Occupancy Group: _____
	Proposed Use: _____		
Description of Work: <u>BSIP (Building Safety Inspection Program)</u>			
☐ New ☐ Addition ☐ Repair ☐ Alteration ☐ Demolition ☐ Revision ☒ Other: <u>BSIP</u>			
Legal Description: <u>VERANO AT MIRAMAR CONDO UNIT 2252-2282 BLDG 18</u> ☐ Attachment			

2	Property Owner: <u>Verano At Miramar</u>	Phone: <u>(305) 979-1396</u>	Email: <u>Nery@soflmanagement.com</u>
	Owner's Address: <u>2199 SW 81 Ave</u>	City: <u>Miramar</u>	State: <u>FL</u> Zip: <u>33025</u>

3	Contracting Co.: _____	Phone: _____	Email: _____
	Company Address: _____	City: _____	State: _____ Zip: _____
	Qualifier's Name: _____	☐ Owner-Builder	License Number: _____

4	Architect/Engineer's Name: <u>Jose Subero</u>	Phone: <u>(941) 223-6457</u>	Email: <u>SuEng40Y@gmail.com</u>
	Architect/Engineer's Address: <u>PO Box 41-4121</u>	City: <u>Miami Beach</u>	State: <u>FL</u> Zip: <u>33141</u>
	Bonding Company: _____		
	Bonding Company's Address: _____	City: _____	State: _____ Zip: _____
	Fee Simple Titleholder's Name (If other than the owner) _____		
	Fee Simple Titleholder's Name (If other than the owner) _____	City: _____	State: _____ Zip: _____
	Mortgage Lender's Name: _____		
	Mortgage Lender's Address: _____	City: _____	State: _____ Zip: _____



- **Building Safety Inspection Report Form – Structural**
- **Building Safety Inspection Report Form – Electrical**
- **Payment of \$300.00 per building payable by cash, check, Visa or MasterCard**

Name of Plaza/Condo Association		
Property Address	2252-2282 SW 81 Ave -Bldg 18 Miramar, FL 33025	ZIP 33025
Folio #	514121AD0130	Building Sq. Ft 20,520 Sq Ft (+/-)
Application Type ☐ Initial Submittal: Tracking # from Notification _____ ☐ Repairs Required Submittal: Tracking # from Notification _____ Permit Numbers for Repairs _____ / _____ / _____		

Name/Association	Verano At Miramar						
Address:	2199 SW 81 Ave	City	Miramar	State	FL	ZIP	33025
Phone #	305 979 1396	Email	Nery@soflmanagement.com				
Contact Name	Nery Perez	Contact Phone	305 979 1396				
Owner's Agent	Nery Perez	Contact Phone	305 979 1396				

Associated Professional # 1: ■ Engineer		☐ Architect		License # <u>72361</u>	
Company Name		Sugil Engineering Inc			
Address		<u>PO Box 41-4121</u>	City	<u>Miami Beach</u>	State <u>FL</u> ZIP <u>33141</u>
Email		<u>SuEng40Y@gmail.com</u>	Phone	<u>941-223-6457</u>	
Contact Name		<u>Jose Subero</u>	Contact Phone	<u>941-223-6457</u>	
Associated Professional # 2: ■ Engineer		☐ Architect		License # <u>72361</u>	
Company Name		Sugil Engineering Inc			
Address		<u>PO Box 41-4121</u>	City	<u>Miami Beach</u>	State <u>FL</u> ZIP <u>33141</u>
Email		<u>SuEng40Y@gmail.com</u>	Phone	<u>941-223-6457</u>	
Contact Name		<u>Jose Subero</u>	Contact Phone	<u>941-223-6457</u>	

Visit <https://www.fortlauderdale.gov/government/departments-a-h/development-services/building-services/40-year-or-older-building-safety-program>

STRUCTURAL SAFETY INSPECTION REPORT FORM



Inspection Firm or Individual Name: Sugil Engineering Inc
 Address: PO Box 41-4121 Miami Beach, FL 33141 email: SuEng40y@gmail.com
 Telephone Number: 941 223 6457
 Inspection Commenced Date: 2/6/24 Inspection Completed Date: 5/15/24


☒ No Repairs Required ☐ Repairs are required as outlined in the attached inspection report

Licensed Design Professional: ☒ Engineer ☐ Architect

Name: Jose R Subero

License Number: PE # 72361

Threshold Building - Certified Special Inspector ☐ Yes ☒ No

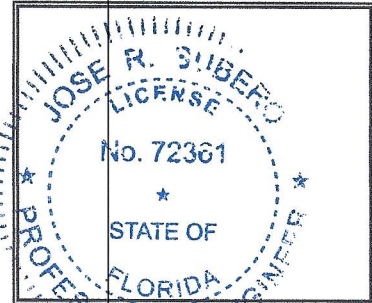

I am qualified to practice in the discipline in which I am hereby signing,

Signature: [Signature]

Date:


MAY 25 2024

This report has been based upon the minimum inspection guidelines for building safety inspection as listed in the Broward County Board of Rules and Appeals' Policy #05-05. To the best of my knowledge and ability, this report represents an accurate appraisal of the present condition of the structure, based upon careful evaluation of observed conditions, to the extent reasonably possible.

1. DESCRIPTION OF STRUCTURE			
a. Name on Title:	Verano At Miramar		
b. Street Address:	2252-2282 SW 81 Ave -Bldg 18		
c. Legal Description:	VERANO AT MIRAMAR CONDO UNIT 2252-2282 BLDG 18		
d. Owner's Name:			
e. Owner's Mailing Address:	2199 SW 81 Ave Miramar, FL 33025		
f. Email Address:	Nerv@sofimanagement.com		
g. Folio Number of Property on which Building is located:	514121AD0130		
h. Building Code Occupancy Classification:	04 Condominium		
i. Present Use:	04 Condominium		
j. General description:	2 Story building. With gable roof. And concrete walls.	Type of Construction:	Concrete frame
k. Square Footage:	20,520 Sq Ft (+/-)	Number of Stories:	2
l. Is this a threshold building (per F.S 553.71)	☐ Yes	☒ No	

m. Special Features: None	
n. Describe any additions to original structure: None	
o. Additional Comments: None MAY 25 2024	

2. PRESENT CONDITION OF STRUCTURE				
a. General Alignment (Note: Good, Fair, Poor, Explain if significant):				
1. Bulging:	☒ Good	☐ Fair	☐ Poor	☐ Significant (Explain):
2. Settlement:	☒ Good	☐ Fair	☐ Poor	☐ Significant (Explain):
3. Deflections:	☒ Good	☐ Fair	☐ Poor	☐ Significant (Explain):
4. Expansion:	☒ Good	☐ Fair	☐ Poor	☐ Significant (Explain):
4. Contraction:	☒ Good	☐ Fair	☐ Poor	☐ Significant (Explain):

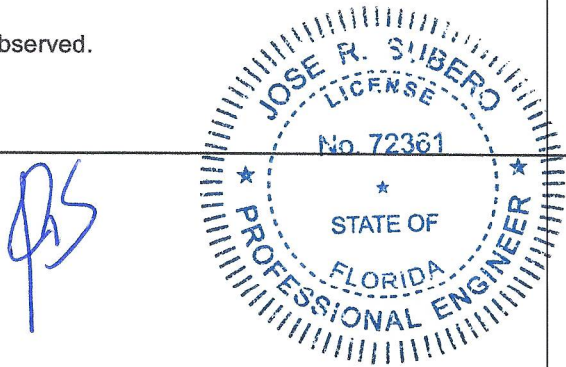b. Portion Showing Distress (Note: Beams, Columns, Structural Walls, Floor, Roofs, Other): No structural distress were observed	
c. Surface Conditions - Describe general conditions of finishes, noting cracking, spalling, peeling, signs of moisture penetration and stains: None observed cracking, spalling, moisture penetration & stains.	
d. Cracks - note location in significant members. Identify crack size as HAIRLINE if barely discernible; FINE if less than 1 mm in width; MEDIUM if between 1 mm and 2 mm in width; WIDE if over 2mm: None Observed cracking.	
e. General extent of deterioration - Cracking or spalling concrete or masonry, oxidation of metals; rot or borer attack in wood: No structural deficiencies were observed.	
f. Note previous patching or repairs: None Observed	
g. Nature of present loading indicate residential, commercial, other estimate magnitude: Residential MAY 25 2024	

3. INSPECTIONS	
a. Date of notice of required inspection:	Unknown
b. Date(s) of actual inspection:	2/6/24

c. Name and qualifications of the individual preparing report: Jose R Subero, PE # 72361. Construction -Building Inspection & Land Development, Civil Engineer	
d. Description of laboratory or other formal testing, if required, rather than manual or visual procedures: None	
e. Structural Repairs: None	
f. Has the property record been researched for any current code violations or unsafe structure cases? Explanation/ Comments: No violations were find	☒ Yes ☐ No
4. SUPPORTING DATA ATTACHED	
a. Sheets of written data: - b. Photographs: 5 c. Drawings or sketches: 1 d. Test reports: -	MAY 25 2024
5. FOUNDATION	
a. Describe building foundation: Reinforced concrete (spread footings & floor slabs)	
b. Has the property record been researched for any current code violations or unsafe structure cases?	☒ Yes ☐ No

c. Has the property record been researched for any current code violations or unsafe structure cases?



Yes

No

d. Describe any cracks or separation in the walls, column or beams that signal differential settlement:
None Observed

e. Is there additional sub-soil investigation required?



Yes



No

1. If yes, explain:

N/A

6 . MASONRY BEARING WALL - Indicate good, fair or poor on appropriate lines

a. Concrete masonry units:



Good



Fair



Poor

b. Clay tile or cotta units:



Good



Fair



Poor

c. Reinforced concrete tie columns:



Good



Fair



Poor

d. Reinforced concrete tie beams:



Good



Fair



Poor

e. Lintel:



Good



Fair



Poor

f. Other type bond beams:



Good



Fair



Poor

g. Masonry Finishes - Exterior:

1. Stucco:



Good



Fair



Poor

2. Veneer:



Good



Fair



Poor

3. Paint Only:



Good



Fair



Poor

4. Other:



Good



Fair




Poor


4a. Explain:


N/A


MAY 25 2024


JS

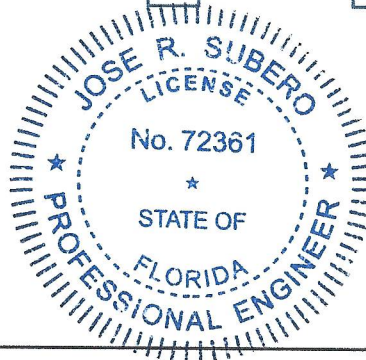

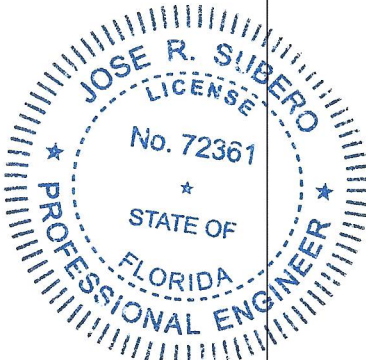h. Cracks - Note beams, columns, or others, including locations (description): No cracks observed in columns and beams	
i. Spalling- In beams, columns, or others, including locations (description): No spalling observed in columns and beams	
j. Rebar corrosion - Check appropriate line: 1. ☒ None Visible 2. ☐ Minor - Patching will suffice 3. ☐ Significant - Patching will suffice 4. ☐ Significant - Structural repairs required 4a. Describe: MAY 25 2024 <i>PS</i> 	
k. Were samples chipped out for examination in spalled areas? 1. ☒ No 2. ☐ Yes - Describe color, texture, aggregate, general quality:	
7. FLOOR AND ROOF SYSTEM	
a. Roof:	
1. Describe type and condition of current roof: Cross Gable - Asphalt shingle - Trusses wood w/ plywood. Good	

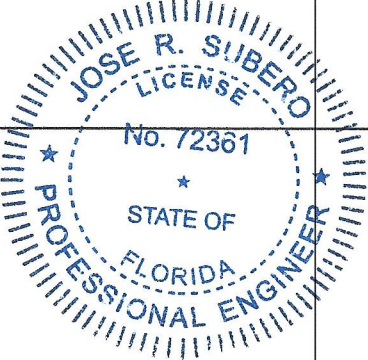2.	Note water tanks, cooling towers, air conditioning, signs, other heavy equipment and condition of support None	
3.	Note types of drains, scuppers, and condition: Metal Drip Edge Good	
4.	Describe parapet construction and current condition: N/A	
5.	Describe mansard construction and current condition: N/A	
6.	Describe any roofing framing member with obvious overloading, overstress, deterioration, or excessive deflection: None observed MAY 25 2024	
7.	Note any expansion joint and condition: None observed PS	

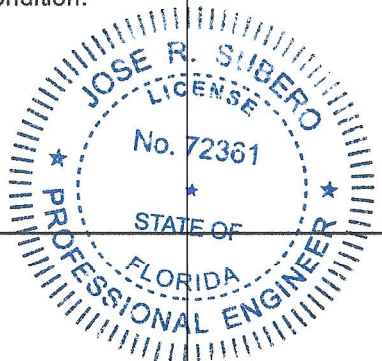b. Floor System(s):	
1. Describe (Type of system framing, material, spans, condition): All Floors - Concrete slab w/ Tiles, Carpet & Hardwood. Good	
2. Balconies - Indicate location, framing system, material and condition: Located back side. Concrete floor w/ aluminium guardrail. Fair	
3. Stairs and escalators - Indicate location, framing system, material and condition: In front and rear to access to second floor.	
4. Ramps - Indicate location, framing system, material and condition: N/A 	
5. Guardrails - Indicate type, location, material and condition: Located Stairs, Hallways and balconies. Aluminiun. Fair MAY 25 2024	
6. Inspection - Note exposed areas available for inspection, and where it was found necessary to open ceilings, etc. for inspection of typical framing members: Most of the framing structural members were exposed for inspection	

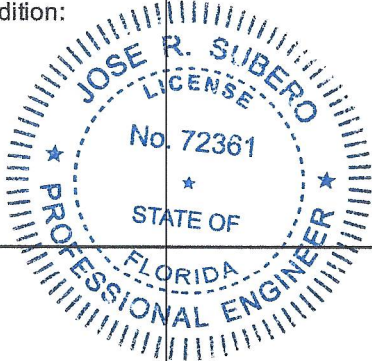b. Floor System(s):	
1. Describe (Type of system framing, material, spans, condition): All Floors - Concrete slab w/ Tiles, Carpet & Hardwood. Good	
2. Balconies - Indicate location, framing system, material and condition: Located back side. Concrete floor w/ aluminium guardrail. Fair	
3. Stairs and escalators - Indicate location, framing system, material and condition: The stairs have concrete steps. Located in front the building floor.	
4. Ramps - Indicate location, framing system, material and condition: N/A MAY 25 2024	
5. Guardrails - Indicate type, location, material and condition: Located Stairs, Hallways and balconies. Alumimium. Fair	
6. Inspection - Note exposed areas available for inspection, and where it was found necessary to open ceilings, etc. for inspection of typical framing members: Most of the framing structural members were exposed for inspection	

8 . STEEL FRAMING SYSTEM

- a. Full description of system:

N/A

- b. Exposed steel - Describe condition of paint and degree of corrosion:

N/A


- c. Steel Connections - Describe type and condition:

N/A

- d. Concrete or other fireproofing - Describe any cracking or spalling and note where any covering was removed for inspection:

N/A

MAY 25 2024

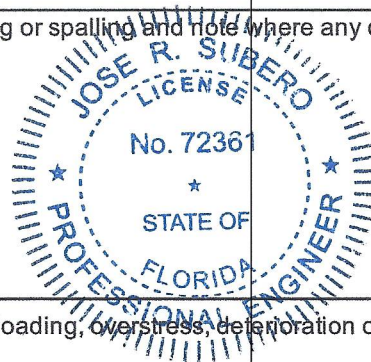

- e. Identify any steel framing member with obvious overloading, overstress, deterioration or excessive deflection (provide location (s)):

None observed

- f. Elevator sheave beams, connections and machine floor beams - Note column:

N/A

9 . CONCRETE FRAMING SYSTEM

a. Full description of structural system:

Reinforced concrete frame (foundations, column, slabs, beams and walls)

b. Cracking:

1. ☐ Significant ☒ Not Significant



2. Description of members affected, location and type of cracking:

No structural deficiencies were observed.

b. General condition:

Good

MAY 25 2024

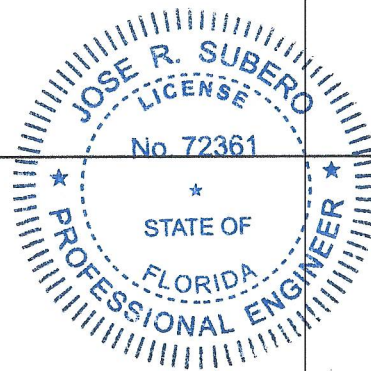

d. Rebar Corrosion - Check appropriate line:

- | | | | |
|----|-------------------------------------|--|-----|
| 1. | ☒ | None Visible | |
| 2. | ☐ | Location and description of members affected and type cracking | |
| 3. | ☐ | Significant - Patching will suffice | |
| 4. | ☐ | Significant - Structural repairs required (Describe): | N/A |

e. Were samples chipped out for examination in spalled areas?

- | | | | |
|----|-------------------------------------|--|-----|
| 1. | ☒ | No | |
| 2. | ☐ | Yes - Describe color, texture, aggregate, general quality: | N/A |

- f. Identify any concrete framing member with obvious overloading, overstress, deterioration or excessive deflection (provide location (s)):
None observed

10 . WINDOWS, STOREFRONTS, CURTAINWALLS AND EXTERIOR DOORS

- a. Windows, Storefronts and Curtainwalls:
Aluminum - Single Hung . Fair

- b. Structural Glazing on the exterior envelope of threshold building: ☐ Yes ☒ No


1. Previous Inspection Date : N/A

2. Description of Curtainwall Structural Glazing and adhesive sealant:
N/A

3. Description condition of system:
N/A

MAY 25 2024

RS

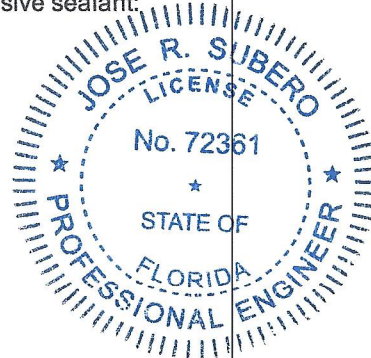

- c. Exterior Doors:
1. Type (wood, steel, aluminum, sliding glass door, other):
Glass & Steel Fair
2. Anchorage type and condition of fasteners and latches:
Screws. Fair

3. Sealant type and condition of sealant:
Caulking. Fair

4. General Condition:
Fair

5. Describe repairs needed:
N/A

11 . WOOD FRAMING

a. Type - Fully describe mill construction, light construction, major spans, trusses:
Trusses wood. Good


MAY 2 5 2024


b. Indicate condition of the following:

1. Walls:
N/A

2. Floors:
N/A

3. Roof member, roof trusses:
Trusses wood. Good

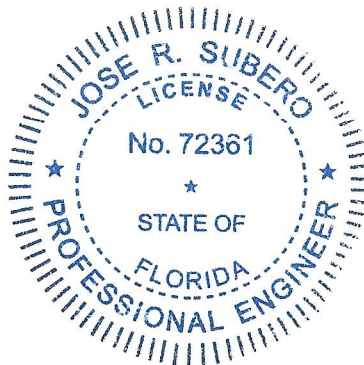

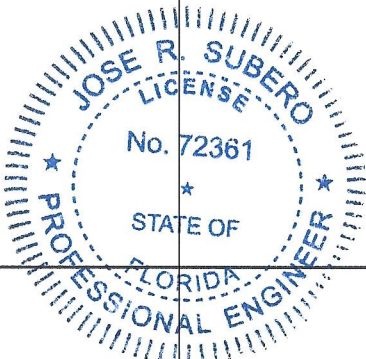c. Note metal fitting (i.e., angles, plates, bolts, splint pintles, other and note condition): Plates. Fair	
d. Joints - Note if weell fitted and still closed: Joint observed to be well fitted & still closed	
e. Dranaige - Note accumulations of moisture: No moisture was observed	
f. Ventilation - Note any concealed spaces not ventilated: Not Observed	
g. Note any concealed spaces opened for inspection: None observed	MAY 25 2024
h. Identify any wood framing member with obvious overloading, overstress, deterioration, or excessive deflection: None observed	

12. BUILDING FAÇADE INSPECTION (Threshold Building)

- a. Identify and describe the exterior walls and appurtenances on all sides of the building (cladding type, corbels, precast appliques, etc.):

N/A

- b. Identify attachment type of each appurtenance type (mechanically attached or adhered):

N/A

- c. Indicate the condition of each appurtenance (distress, settlement, splitting, bulging, cracking, loosening of metal anchors and supports, water entry, movement of lintel or shelf angles or other defects):

N/A


13. SPECIAL OR UNUSUAL FEATURES IN THE BUILDING

- a. Identify and describe any special or unusual features (i.e., cable suspended structures, tensile fabric roof, large sculptures, chimney, porte-cochere, retaining walls, seawalls, etc):

N/A

- b. Indicate condition of special feature, its supports and connections:

N/A

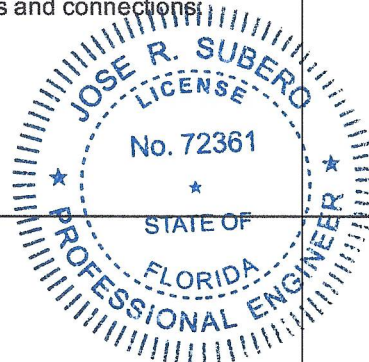

MAY 25 2024

2252-2282 SW

81 Ave -Bldg 18

JS



MAY 2 5 2024



SUGIL ENGINEERING INC
PO Box 41-4121
Miami Beach, FL 33141

Building 1




Front View



Right Side View



Rear Side View

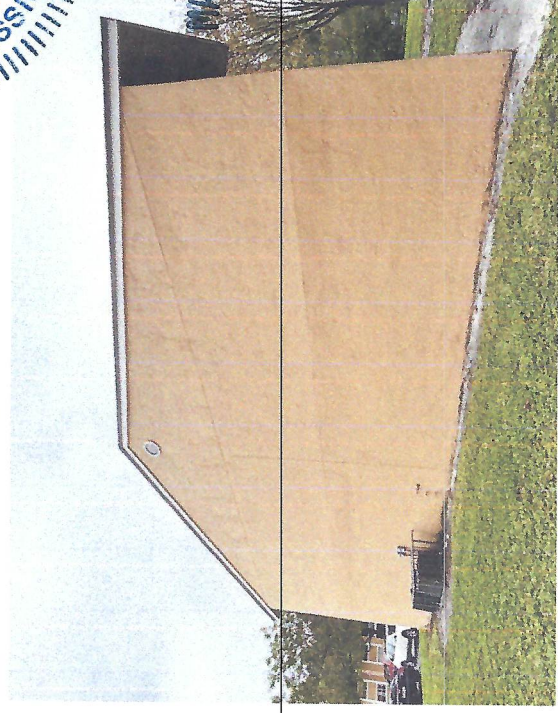

Left Side View

RS



MAY 25 2024

Meter Room



BS



MAY 25 2024

ELECTRICAL SAFETY INSPECTION REPORT FORM

Inspection Firm or Individual Name: Sugil Engineering IncAddress: PO Box 41-4121 Miami Beach, FL 33141 email: SuEng40y@gmail.comTelephone Number: 941 223 6457Inspection Commenced Date: 2/6/24 Inspection Completed Date: 5/15/24
☒ No Repairs Required
 ☐ Repairs are required as outlined in the attached inspection report

Licensed Design Professional: _____


Name: Jose R SuberoLicense Number: PE # 72361

P.E. Specialized in Electrical Design

Yes

No

Provide resume of qualifications upon request

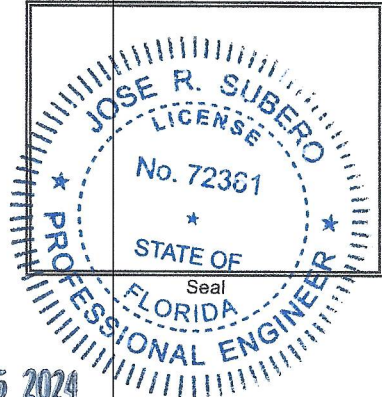

I am qualified to practice in the discipline in which I am hereby signing.

Signature: _____

Date: MAY 25 2024

This report has been based upon the minimum inspection guidelines for building safety inspection as listed in the Broward County Board of Rules and Appeals' Policy #05-05. To the best of my knowledge and ability, this report represents an accurate appraisal of the present condition of the structure, based upon careful evaluation of observed conditions, to the extent reasonably possible.

1. DESCRIPTION OF STRUCTURE	
a. Name on Title:	Verano At Miramar
b. Street Address:	2252-2282 SW 81 Ave -Bldg 18
c. Legal Description:	VERANO AT MIRAMAR CONDO UNIT 2252-2282 BLDG 18
d. Owner's Name:	Verano At Miramar
e. Owner's Mailing Address:	2199 SW 81 Ave Miramar, FL 33025
f. Email Address:	<u>Nery@softmanagement.com</u> Contact Number: <u>305 979 1396</u>
g. Folio Number of Property on which Building is located:	514121AD0130
h. Building Code Occupancy Classification:	04 Condominium
i. Present Use:	04 Condominium
j. General description: 2 Story building. With gable roof. And concrete walls.	Type of Construction: Concrete frame
k. Square Footage: 20,520 Sq Ft (+/-)	Number of Stories: 2
l. Special Features:	None

m. Additional Comments: None

2. INSPECTIONS

a. Date of notice of required inspection: Unknown

b. Date(s) of actual inspection: 2/6/24

c. Name and qualifications of individual preparing report:

Jose R Subero PE # 72361

d. Are any electrical repairs required?

1.

☒


No - None required

2.

Yes - Required (Describe nature of repairs):

JS

MAY 25 2024

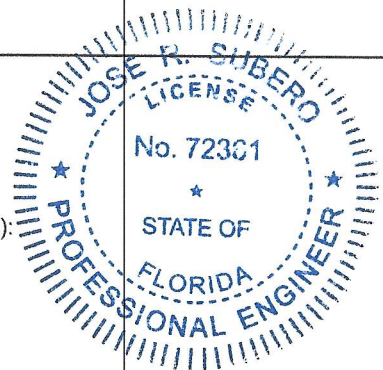

*** NOTE: Provide Photographs as necessary to reflect relevant conditions and index appropriately ***

3. ELECTRIC SERVICE

a. Size: Voltage (120/240); Voltage (120/240);


b. Main Service Protection: (800 amps): ☐ Fuses ☒ Breaker

c. Service Rating Amperage: (+/- 125 amps):
Each unit

d. Phase: ☐ Three Phase ☒ Single Phase

e. Condition:	☒ Good	☐ Need Repairs
Describe nature of repairs: N/A		

4. SERVICE EQUIPMENT		
a. Clearances:	☒ Good	☐ Require Repair
Describe nature of repairs: N/A		

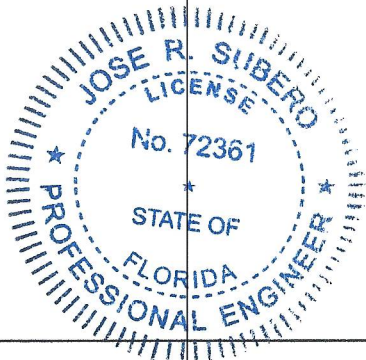5. ELECTRIC ROOMS		
a. Clearances:	☒ Good	☐ Require Repair
Describe nature of repairs: N/A		
MAY 25 2024 <i>PS</i> 		

6. GUTTERS, WIREWAYS, ETC.		
a. Location:	☒ Good	☐ Require Repair
Describe nature of repairs: N/A		
Broward County BORA - Policy 05-05		
5.90b		

b. Tap and box fill: ☒ Good ☐ Need Repairs

Describe nature of repairs: N/A

7. ELECTRICAL SWITCHGEAR

a. Panel # (2252): ☒ Good ☐ Need repair

b. Panel # (2254): ☒ Good ☐ Need repair

c. Panel # (2256): ☒ Good ☐ Need repair


d. Panel # (2278): ☒ Good ☐ Need repair

e. Panel # (2282): ☒ Good ☐ Need repair

Describe nature of repairs: N/A

MAY 25 2024

BS

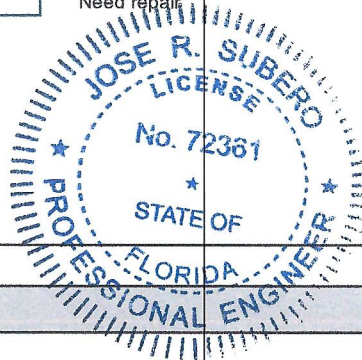

8. BRANCH CIRCUITS

a. Identified ☒ Yes ☐ Must be identified

b. Conductors: ☒ Good ☐ Deteriorated ☐ Must be replaced

Describe nature of repairs: N/A

Describe nature of repairs: N/A

9. GROUNDING SERVICE

Good



Repairs Required

Comments: No comments.

10. GROUNDING OF EQUIPMENT


Good



Repairs Required

Comments: No comments.

MAY 25 2024

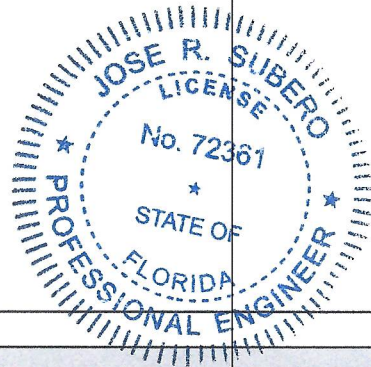**11. SERVICE CONDUITS / RACEWAYS**

Good



Repairs Required

Comments: No comments.

12. SERVICE CONDUCTOR AND CABLES

Good



Repairs Required

Comments: No comments.

13. GENERAL CONDUIT/RACEWAYS

Good



Repairs Required

Comments: No comments.


14. FEEDER CONDUCTORS

Good



Repairs Required

Comments: No comments.

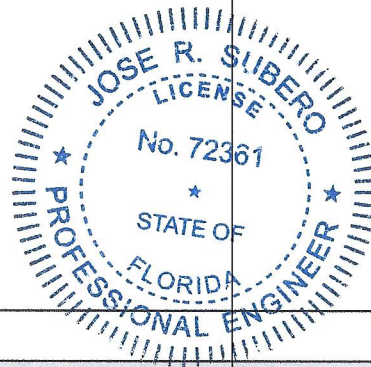**15. BUSWAYS**

Good



Repairs Required

Comments: N/A. This is not busways.

MAY 2 5 2024

16. OTHER CONDUCTORS

Good



Repairs Required

Comments: N/A. This is not others conductors

17. EMERGENCY LIGHTING☐

Good

☐

Repairs Required

Comments: N/A. Emergency lights are not required


18. BUILDING EGRESS ILLUMINATION☒

Good

☐

Repairs Required

Comments: No comments

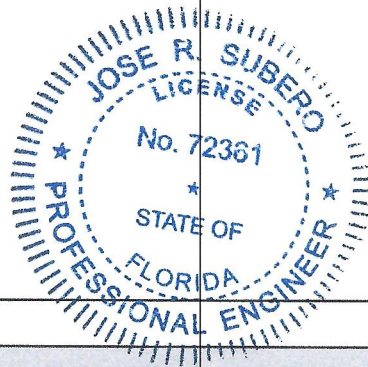**19. FIRE ALARM SYSTEM**☐

Good

☐

Repairs Required

Comments: N/A. Fire Alarm System is not required

MAY 25 2024

20. SMOKE DETECTORS☒

Good

☐

Repairs Required

Comments: No comments

21. EXIT LIGHTS☐

Good

☐

Repairs Required

Comments: N/A. Exit lights are not required

22. EMERGENCY POWER SYSTEMS☐

Good

☐

Repairs Required

Comments: N/A. Emergency generator is not required


23. WIRING & CONDUIT AT ALL PARKING LOTS AND GARAGES☒

Good

☐

Repairs Required

Comments: No comments

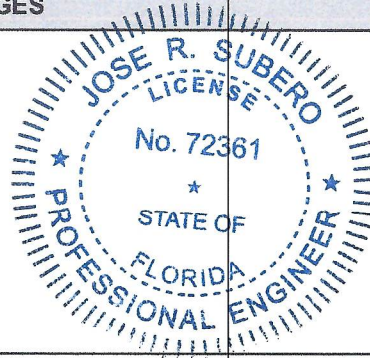**24. SWIMMING POOL WIRING**☐

Good

☐

Repairs Required

Comments: N/A. There is not swimming pool in this property.

MAY 25 2024

25. WIRING TO MECHANICAL EQUIPMENT



Good




Repairs Required

Comments:

No comments

JS

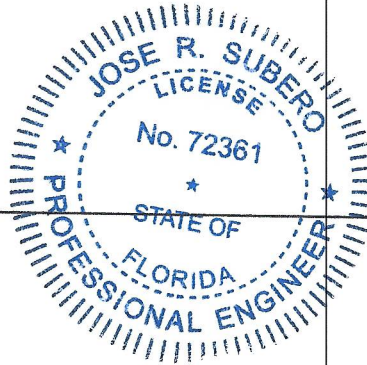

MAY 25 2024