

BROWARD COUNTY UNIFORM BUILDING PERMIT APPLICATION

Revised 11-17-2022

Select One Trade:



Application Number: _____

Application Date: _____

Job Address: **2284-2298 SW 81 Ave**

Unit: _____

City: **Miramar**

Tax Folio No.: **514121AC2160- 2170**

Flood Zn: _____

BFE: _____

Floor Area: _____

Job Value: _____

Building Use: **04 Condominium**


Construction Type: _____

Occupancy Group: _____

Present Use: **04 Condominiumg**

Proposed Use: _____

Description of Work: **BSIP (Building Safety Inspection Program)**



Legal Description: **VERANO AT MIRAMAR CONDO UNIT 2284-2298 BLDG 19**



Property Owner: **Verano At Miramar** Phone: **(305) 979-1396** Email: **Nery@soflmanagement.com**

Owner's Address: **2199 SW 81 Ave** City: **Miramar** State: **FL** Zip: **33025**

Contracting Co.: _____ Phone: _____ Email: _____

Company Address: _____ City: _____ State: _____ Zip: _____

Qualifier's Name: _____ ☐ Owner-Builder License Number: _____

Architect/Engineer's Name: **Jose Subero** Phone: **(941) 223-6457** Email: **SuEng40Y@gmail.com**

Architect/Engineer's Address: **PO Box 41-4121** City: **Miami Beach** State: **FL** Zip: **33141**

Bonding Company: _____

Bonding Company's Address: _____ City: _____ State: _____ Zip: _____

Fee Simple Titleholder's Name (If other than the owner) _____

Fee Simple Titleholder's Name (If other than the owner) _____ City: _____ State: _____ Zip: _____

Mortgage Lender's Name: _____

STRUCTURAL SAFETY INSPECTION REPORT FORM




Inspection Firm or Individual Name: Sugil Engineering Inc
 Address: PO Box 41-4121 Miami Beach, FL 33141 email: SuEng40y@gmail.com
 Telephone Number: 941 223 6457
 Inspection Commenced Date: 2/6/24 Inspection Completed Date: 5/15/24

☒ No Repairs Required ☐ Repairs are required as outlined in the attached inspection report

Licensed Design Professional: ☒ Engineer ☐ Architect

Name: Jose R Subero
 License Number: PE # 72361
 Threshold Building - Certified Special Inspector ☐ Yes ☒ No

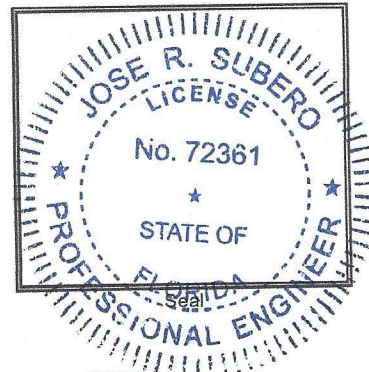

I am qualified to practice in the discipline in which I am hereby signing,

Signature: [Signature] Date: MAY 25 2024

This report has been based upon the minimum inspection guidelines for building safety inspection as listed in the Broward County Board of Rules and Appeals' Policy #05-05. To the best of my knowledge and ability, this report represents an accurate appraisal of the present condition of the structure, based upon careful evaluation of observed conditions, to the extent reasonably possible.

1. DESCRIPTION OF STRUCTURE			
a. Name on Title:	Verano At Miramar		
b. Street Address:	2284-2298 SW 81 Ave		
c. Legal Description:	VERANO AT MIRAMAR CONDO UNIT 2284-2298 BLDG 19		
d. Owner's Name:	Verano At Miramar		
e. Owner's Mailing Address:	2199 SW 81 Ave Miramar, FL 33025		
f. Email Address:	jay@softmanagement.com		
g. Folio Number of Property on which Building is located:	514121AC2160 Through 514121AC2170		
h. Building Code Occupancy Classification:	04 Condominium		
i. Present Use:	04 Condominium		
j. General description:	2 Story building. With Cross Hipped Roof. And concrete walls.	Type of Construction:	Concrete frame
k. Square Footage:	10,260 Sq ft (+/-)	Number of Stories:	2
l. Is this a threshold building (per F.S 553.71)	☐ Yes	☒ No	


m. Special Features: None

n. Describe any additions to original structure: None

o. Additional Comments: None

MAY 25 2024

PS

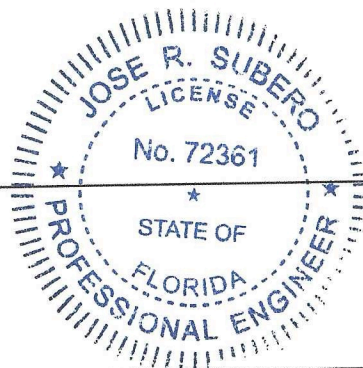

2. PRESENT CONDITION OF STRUCTURE

a. General Alignment (Note: Good, Fair, Poor, Explain if significant):

- | | | | | |
|-----------------|---|-------------------------------|-------------------------------|---|
| 1. Bulging: | ☒ Good | ☐ Fair | ☐ Poor | ☐ Significant (Explain): |
| 2. Settlement: | ☒ Good | ☐ Fair | ☐ Poor | ☐ Significant (Explain): |
| 3. Deflections: | ☒ Good | ☐ Fair | ☐ Poor | ☐ Significant (Explain): |
| 4. Expansion: | ☒ Good | ☐ Fair | ☐ Poor | ☐ Significant (Explain): |
| 4. Contraction: | ☒ Good | ☐ Fair | ☐ Poor | ☐ Significant (Explain): |

b. Portion Showing Distress (Note: Beams, Columns, Structural Walls, Floor, Roofs, Other):

No structural distress were observed

c. Surface Conditions - Describe general conditions of finishes, noting cracking, spalling, peeling, signs of moisture penetration and stains:

None observed cracking, spalling, moisture penetration & stains.

d. Cracks - note location in significant members. Identify crack size as HAIRLINE if barely discernible; FINE if less than 1 mm in width; MEDIUM if between 1mm and 2 mm in width; WIDE if over 2mm:

None Observed cracking.


e. General extent of deterioration - Cracking or spalling concrete or masonry, oxidation of metals; rot or borer attack in wood:

No structural deficiencies were observed.

f. Note previous patching or repairs:

None Observed

JS

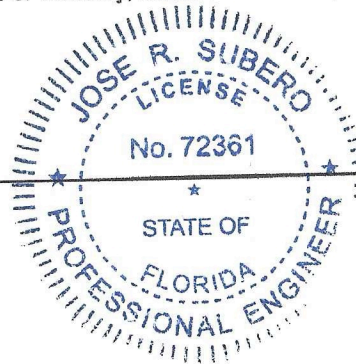

g. Nature of present loading indicate residential, commercial, other estimate magnitude:

Residential


MAY 25 2024

3. INSPECTIONS

a. Date of notice of required inspection: Unknown

b. Date(s) of actual inspection: 2/6/24

c. Name and qualifications of the individual preparing report: Jose R Subero, PE # 72361. Construction -Building Inspection & Land Development. Civil Engineer	
d. Description of laboratory or other formal testing, if required, rather than manual or visual procedures: None	
e. Structural Repairs: None	
f. Has the property record been researched for any current code violations or unsafe structure cases? ☒ Yes ☐ No	
Explanation/ Comments: No violations were find MAY 25 2024	
4. SUPPORTING DATA ATTACHED	
a. Sheets of written data: - b. Photographs: 5 c. Drawings or sketches: 1 d. Test reports: -	
5. FOUNDATION	
a. Describe building foundation: Reinforced concrete (spread footings & floor slabs)	
b. Has the property record been researched for any current code violations or unsafe structure cases? ☒ Yes ☐ No	

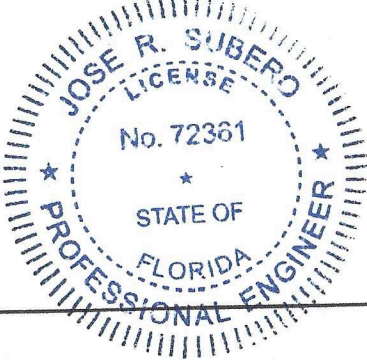c. Has the property record been researched for any current code violations or unsafe structure cases?		☒ Yes	☐ No
d. Describe any cracks or separation in the walls, column or beams that signal differential settlement: None Observed			
e. Is there additional sub-soil investigation required?		☐ Yes	☒ No
1. If yes, explain: N/A			
6. MASONRY BEARING WALL - Indicate good, fair or poor on appropriate lines			
a. Concrete masonry units:	☐ Good	☒ Fair	☐ Poor
b. Clay tile or cotta units:	☐ Good	☐ Fair	☐ Poor
c. Reinforced concrete tie columns:	☒ Good	☐ Fair	☐ Poor
d. Reinforced concrete tie beams:	☒ Good	☐ Fair	☐ Poor
e. Lintel:	☐ Good	☐ Fair	☐ Poor
f. Other type bond beams:	☐ Good	☐ Fair	☐ Poor
g. Masonry Finishes - Exterior:			
1. Stucco:	☐ Good	☒ Fair	☐ Poor
2. Veneer:	☐ Good	☐ Fair	☐ Poor
3. Paint Only:	☐ Good	☒ Fair	☐ Poor
4. Other:	☐ Good	☐ Fair	☐ Poor
4a. Explain: N/A			
MAY 25 2024  			

h. Cracks - Note beams, columns, or others, including locations (description):

No cracks observed in columns and beams

i. Spalling- In beams, columns, or others, including locations (description):

No spalling observed in columns and beams


j. Rebar corrosion - Check appropriate line:

1. ☒ None Visible
2. ☐ Minor - Patching will suffice
3. ☐ Significant - Patching will suffice
4. ☐ Significant - Structural repairs required

4a. Describe:

MAY 25 2024

JS

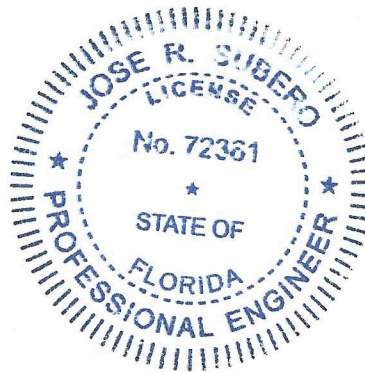

k. Were samples chipped out for examination in spalled areas?

1. ☒ No
2. ☐ Yes - Describe color, texture, aggregate, general quality:

7. FLOOR AND ROOF SYSTEM


a. **Roof:**

1. Describe type and condition of current roof:


Cross hipped roof w/ - Asphalt shingle - Trusses wood w/ plywood. Good

2.	Note water tanks, cooling towers, air conditioning, signs, other heavy equipment and condition of support
	None
3.	Note types of drains, scuppers, and condition:
	Metal Drip Edge Fair
4.	Describe parapet construction and current condition:
	N/A
5.	Describe mansard construction and current condition:
	N/A
	MAY 25 2024
6.	Describe any roofing framing member with obvious overloading, overstress, deterioration, or excessive deflection:
	None observed
7.	Note any expansion joint and condition:
	None observed

JS

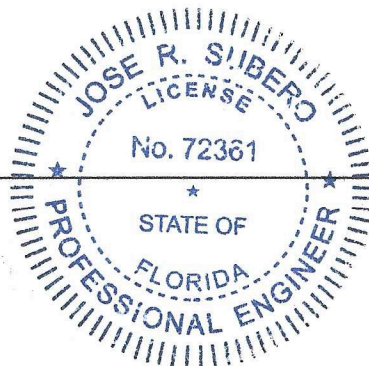

b. Floor System(s):
1. Describe (Type of system framing, material, spans, condition): All Floors - Concrete slab w/ Tiles, Carpet & Hardwood. Good
2. Balconies - Indicate location, framing system, material and condition: Located back side. Concrete floor w/ aluminium guardrail. Fair
3. Stairs and escalators - Indicate location, framing system, material and condition: The stairs have concrete steps. In front to access to second floor. Fair
4. Ramps - Indicate location, framing system, material and condition: N/A MAY 25 2024 <i>[Handwritten Signature]</i>
5. Guardrails - Indicate type, location, material and condition: Located Stairs, Hallways and balconies. Aluminiun. Fair
6. Inspection - Note exposed areas available for inspection, and where it was found necessary to open ceilings, etc. for inspection of typical framing members: Most of the framing structural members were exposed for inspection

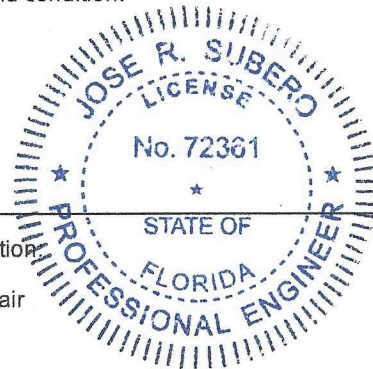

8. STEEL FRAMING SYSTEM

- a. Full description of system:

N/A

- b. Exposed steel - Describe condition of paint and degree of corrosion:

N/A

- c. Steel Connections - Describe type and condition:

N/A

- d. Concrete or other fireproofing - Describe any cracking or spalling and note where any covering was removed for inspection:


N/A

MAY 25 2024

- e. Identify any steel framing member with obvious overloading, overstress, deterioration or excessive deflection (provide location (s)):

None observed

BS

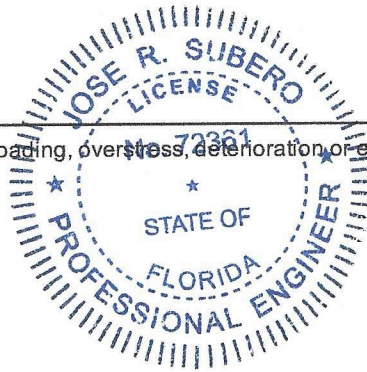

- f. Elevator sheave beams, connections and machine floor beams - Note column:

N/A

9 . CONCRETE FRAMING SYSTEM

a. Full description of structural system:

Reinforced concrete frame (foundations, column, slabs, beams and walls)

b. Cracking:

1. ☐ Significant ☒ Not Significant

2. Description of members affected, location and type of cracking:


No structural deficiencies were observed.

b. General condition:

Good

MAY 25 2024

PS

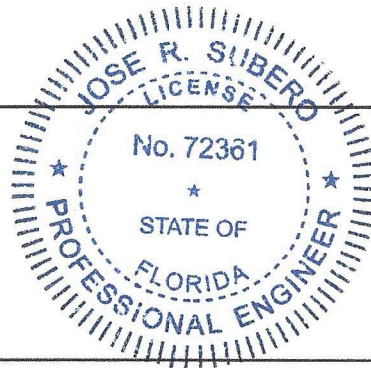

d. Rebar Corrosion - Check appropriate line:

- | | | | |
|----|-------------------------------------|--|-----|
| 1. | ☒ | None Visible | |
| 2. | ☐ | Location and description of members affected and type cracking | |
| 3. | ☐ | Significant - Patching will suffice | |
| 4. | ☐ | Significant - Structural repairs required (Describe): | N/A |

e. Were samples chipped out for examination in spalled areas?

- | | | | |
|----|-------------------------------------|--|-----|
| 1. | ☒ | No | |
| 2. | ☐ | Yes - Describe color, texture, aggregate, general quality: | N/A |

- f. Identify any concrete framing member with obvious overloading, overstress, deterioration or excessive deflection (provide location (s)):
None observed

10 . WINDOWS, STOREFRONTS, CURTAINWALLS AND EXTERIOR DOORS

- a. Windows, Storefronts and Curtainwalls:

Aluminum - Single Hung . Fair

- b. Structural Glazing on the exterior envelope of threshold building:

☐

Yes

☒

No

1. Previous Inspection Date : N/A


2. Description of Curtainwall Structural Glazing and adhesive sealant:

N/A

MAY 25 2024

3. Description condition of system:

N/A

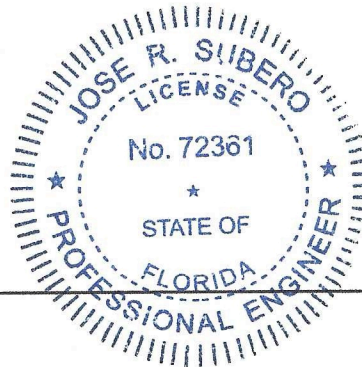

- c. Exterior Doors:

1. Type (wood, steel, aluminum, sliding glass door, other):

Glass & Steel Fair

2. Anchorage type and condition of fasteners and latches:

Screws. Fair

3. Sealant type and condition of sealant:

Caulking. Fair

4. General Condition:

Fair

5. Describe repairs needed:

N/A

11. WOOD FRAMING

- a. Type - Fully describe mill construction, light construction, major spans, trusses:

Trusses wood. Good

MAY 25 2024

- b. Indicate condition of the following:

1. Walls:

N/A


2. Floors:


N/A

3. Roof member, roof trusses:

Trusses wood. Good

JS

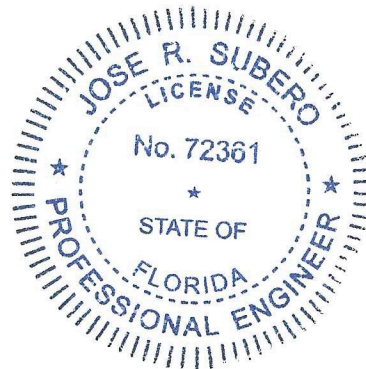

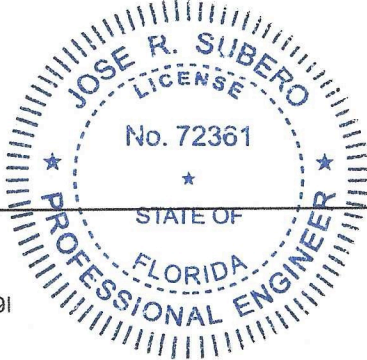c. Note metal fitting (i.e., angles, plates, bolts, splint pintles, other and note condition): Plates. Fair
d. Joints - Note if weell fitted and still closed: Joint observed to be well fitted & still closed
e. Dranaige - Note accumulations of moisture: No moisture was observed
f. Ventilation - Note any concealed spaces not ventilated: Not Observed
g. Note any concealed spaces opened for inspection: None observed MAY 25 2024
h. Identify any wood framing member with obvious overloading, overstress, deterioration, or excessive deflection: None observed  

12. BUILDING FAÇADE INSPECTION (Threshold Building)

- a. Identify and describe the exterior walls and appurtenances on all sides of the building (cladding type, corbels, precast appliques, etc.):

N/A

- b. Identify attachment type of each appurtenance type (mechanically attached or adhered):

N/A

- c. Indicate the condition of each appurtenance (distress, settlement, splitting, bulging, cracking, loosening of metal anchors and supports, water entry, movement of lintel or shelf angles or other defects):

N/A

13. SPECIAL OR UNUSUAL FEATURES IN THE BUILDING

- a. Identify and describe any special or unusual features (i.e., cable suspended structures, tensile fabric roof, large sculptures, chimney, porte-cochere, retaining walls, seawalls, etc):


N/A

MAY 25 2024

- b. Indicate condition of special feature, its supports and connections:

N/A

BS

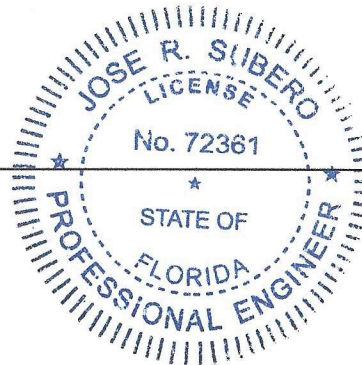




2284-2298 SW
81 Ave

JS

MAY 25 2024

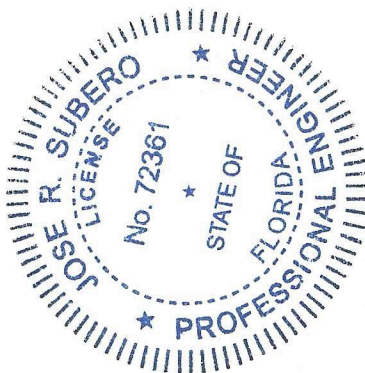

SUGIL ENGINEERING INC
PO Box 41-4121
Miami Beach, FL 33141

MAY 25 2024

Building 19




Front View



Right Side View




Rear Side View

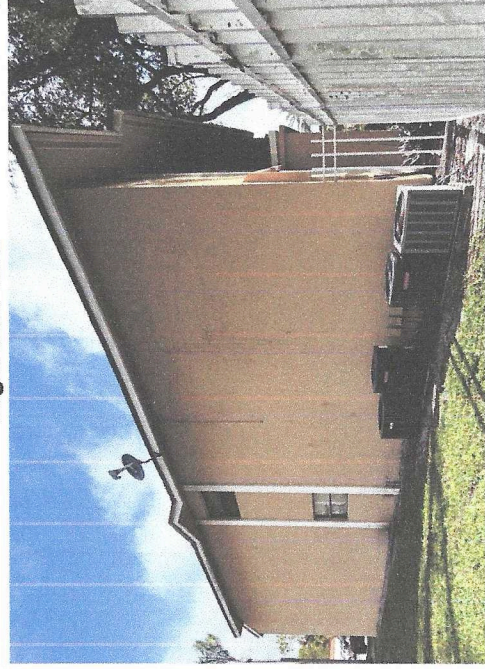



Left Side View

RS

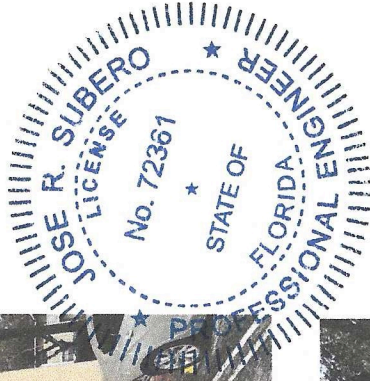

MAY 25 2024

Meter Room

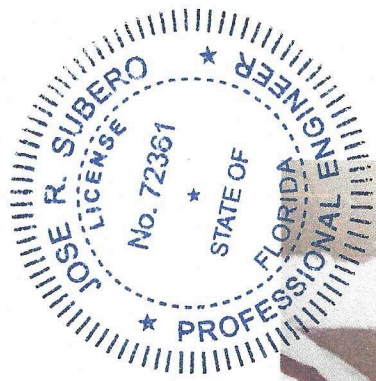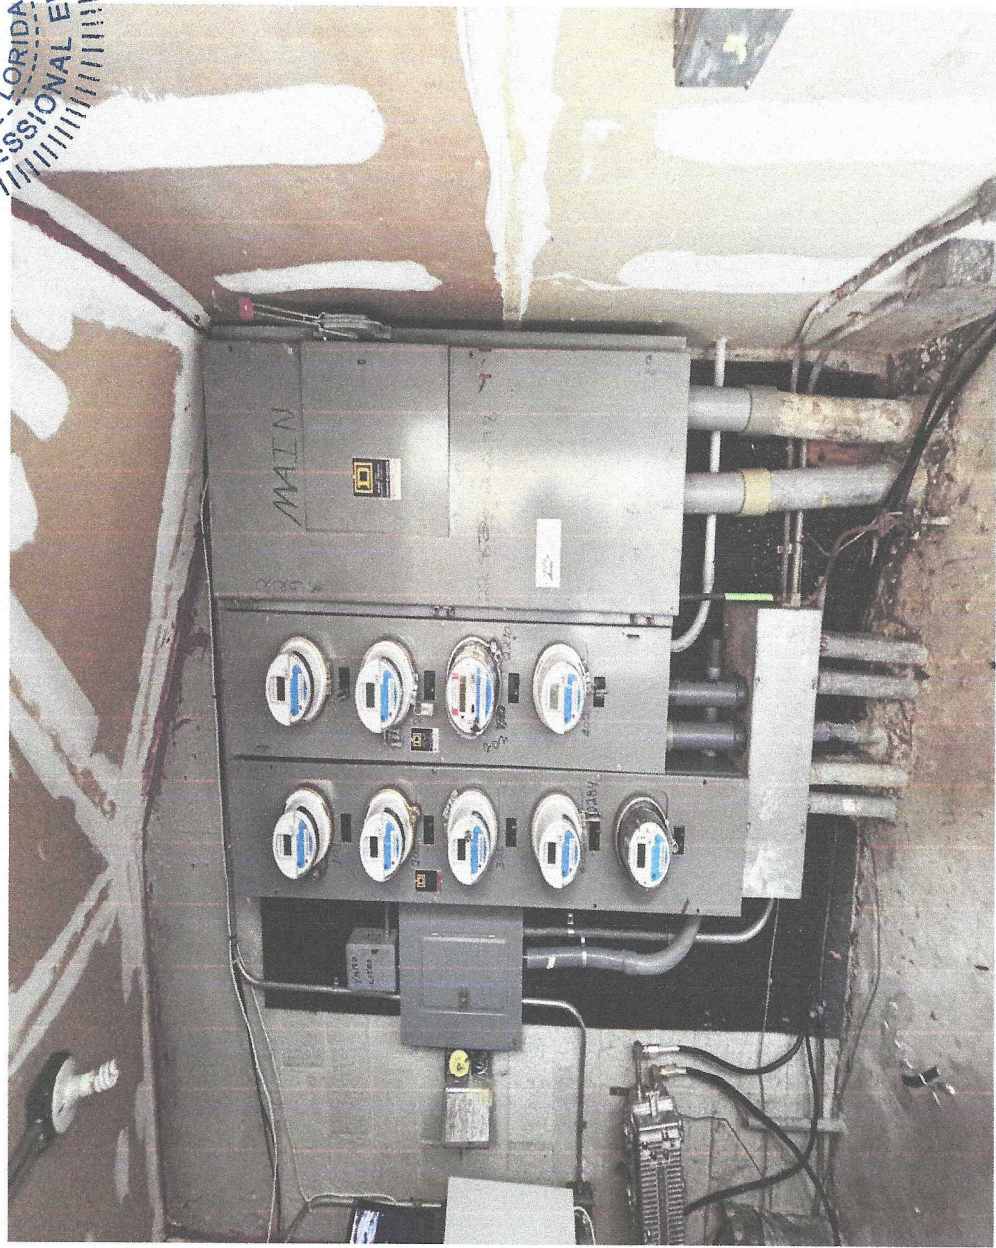

JS


ELECTRICAL SAFETY INSPECTION REPORT FORM



Inspection Firm or Individual Name: Sugil Engineering Inc
 Address: PO Box 41-4121 Miami Beach, FL 33141 email: SuEng40y@gmail.com
 Telephone Number: 941 223 6457
 Inspection Commenced Date: 2/6/24 Inspection Completed Date: 5/15/24
☒ No Repairs Required ☐ Repairs are required as outlined in the attached inspection report

Licensed Design Professional: _____
 Name: Jose R Subero
 License Number: PE # 72361
 P.E. Specialized in Electrical Design ☐ Yes ☒ No

Provide resume of qualifications upon request

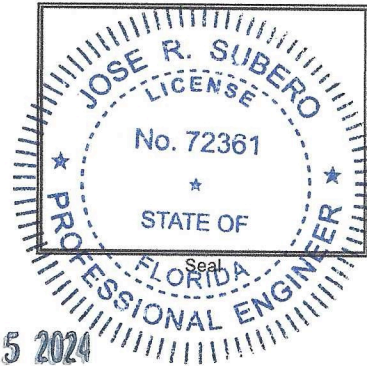

I am qualified to practice in the discipline in which I am hereby signing,

Signature:  Date: MAY 25 2024

This report has been based upon the minimum inspection guidelines for building safety inspection as listed in the Broward County Board of Rules and Appeals' Policy #05-05. To the best of my knowledge and ability, this report represents an accurate appraisal of the present condition of the structure, based upon careful evaluation of observed conditions, to the extent reasonably possible.

1. DESCRIPTION OF STRUCTURE	
a. Name on Title:	Verano At Miramar
b. Street Address:	2284-2298 SW 81 Ave
c. Legal Description:	VERANO AT MIRAMAR CONDO UNIT 2284-2298 BLDG 19
d. Owner's Name:	Verano At Miramar
e. Owner's Mailing Address:	2199 SW 81 Ave Miramar, FL 33025
f. Email Address:	<u>jay@soflmanagement.com</u> Contact Number: <u>305 799 5049</u>
g. Folio Number of Property on which Building is located:	514121AC2160 Through 514121AC2170
h. Building Code Occupancy Classification:	04 Condominium
i. Present Use:	04 Condominium
j. General description:	2 Story building. With Cross Hipped Roof. And concrete walls. Type of Construction: Concrete frame
k. Square Footage:	10,260 Sq ft (+/-) Number of Stories: 2
l. Special Features:	None

m. Additional Comments: None

2. INSPECTIONS

a. Date of notice of required inspection: Unknown

b. Date(s) of actual inspection: 2/6/24

c. Name and qualifications of individual preparing report:

Jose R Subero PE # 72361

MAY 25 2024

d. Are any electrical repairs required?

1.


☒

No - None required

2.

Yes - Required (Describe nature of repairs):

JS

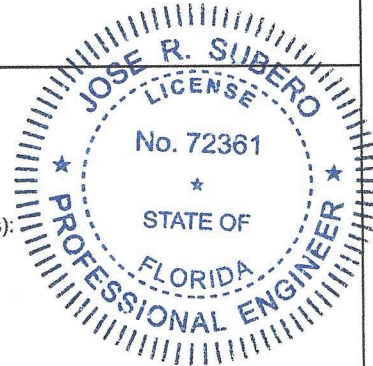

*** NOTE: Provide Photographs as necessary to reflect relevant conditions and index appropriately ***

3. ELECTRIC SERVICE

a. Size: Voltage (120/240); Voltage (120/240);

b. Main Service Protection: (600 amps): ☐ Fuses ☒ Breaker
Building

c. Service Rating Amperage: (+/- 100 amps):
Each unit

d. Phase: ☐ Three Phase ☒ Single Phase

e. Condition: ☒ Good ☐ Need Repairs

Describe nature of repairs: N/A

4. SERVICE EQUIPMENT

a. Clearances: ☒ Good ☐ Require Repair

Describe nature of repairs: N/A


MAY 25 2024

5. ELECTRIC ROOMS

a. Clearances: ☒ Good ☐ Require Repair

Describe nature of repairs: N/A

JB

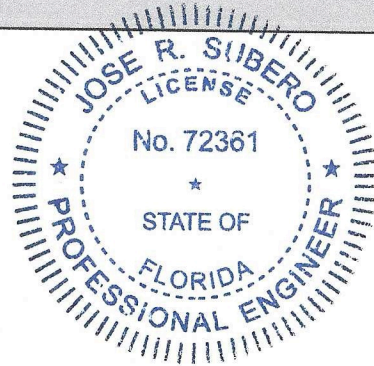

6. GUTTERS, WIREWAYS, ETC.

a. Location: ☒ Good ☐ Require Repair

Describe nature of repairs: N/A

b. Tap and box fill: ☒ Good ☐ Need Repairs

Describe nature of repairs: N/A

7. ELECTRICAL SWITCHGEAR

a. Panel # (2284): ☒ Good ☐ Need repair

b. Panel # (2290): ☒ Good ☐ Need repair

c. Panel # (2292): ☒ Good ☐ Need repair

d. Panel # (2294): ☒ Good ☐ Need repair

e. Panel # (2296): ☒ Good ☐ Need repair

Describe nature of repairs: N/A

MAY 25 2024

8. BRANCH CIRCUITS


a. Identified ☒ Yes ☐ Must be identified

b. Conductors: ☒ Good ☐ Deteriorated

Describe nature of repairs: N/A

Describe nature of repairs: N/A

JS

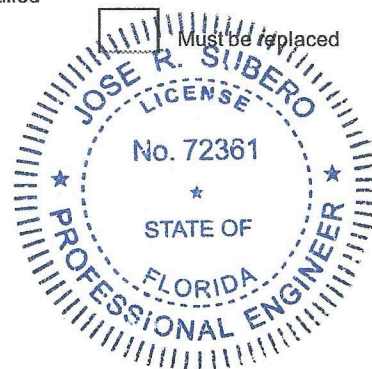

9. GROUNDING SERVICE



Good



Repairs Required

Comments: No comments.

10. GROUNDING OF EQUIPMENT



Good



Repairs Required

Comments: No comments.

MAY 25 2024

11. SERVICE CONDUITS / RACEWAYS




Good



Repairs Required

Comments: No comments.

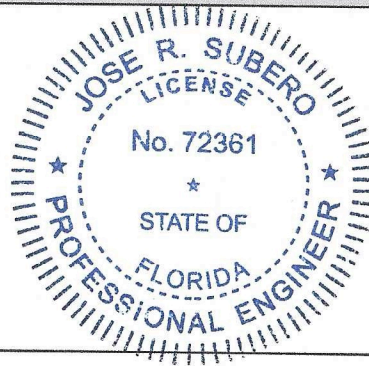

12. SERVICE CONDUCTOR AND CABLES



Good



Repairs Required

Comments: No comments.

13. GENERAL CONDUIT/RACEWAYS



Good



Repairs Required

Comments: No comments.

14. FEEDER CONDUCTORS



Good



Repairs Required

Comments: No comments.

MAY 25 2024

15. BUSWAYS




Good



Repairs Required

Comments: N/A. This is not busways.

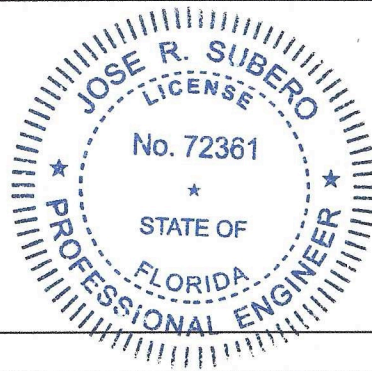

16. OTHER CONDUCTORS



Good



Repairs Required

Comments: N/A. This is not others conductors

17. EMERGENCY LIGHTING

☐

Good

☐

Repairs Required

Comments: N/A. Emergency lights are not required

18. BUILDING EGRESS ILLUMINATION

☒

Good

☐

Repairs Required

Comments: No comments

MAY 25 2024

19. FIRE ALARM SYSTEM

☐


Good

☐

Repairs Required

Comments: N/A. Fire Alarm System is not required

RS

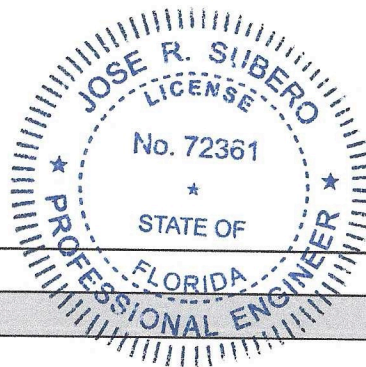

20. SMOKE DETECTORS

☒

Good

☐

Repairs Required

Comments: No comments

21. EXIT LIGHTS

☐

Good

☐

Repairs Required

☐

Comments: N/A. Exit lights are not required

22. EMERGENCY POWER SYSTEMS

☐

Good

☐

Repairs Required

Comments: N/A. Emergency generator is not required

MAY 25 2024

23. WIRING & CONDUIT AT ALL PARKING LOTS AND GARAGES

☒


Good

☐

Repairs Required

Comments: No comments

JS

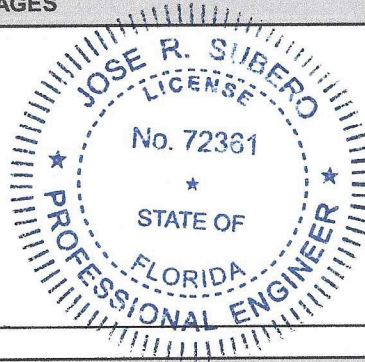

24. SWIMMING POOL WIRING

☐

Good

☐

Repairs Required

Comments: N/A. There is not swimming pool in this property.

25. WIRING TO MECHANICAL EQUIPMENT	
☒	Good
☐	Repairs Required
Comments:	No comments

MAY 2 5 2024

JS

